


This print and associated documents and the contained information are the confidential property of ELECTRONIC CABLE SPECIALISTS. Disclosure of, and/or reproduction of, all or part thereof or manufacture of any part from information contained on this print not specifically permitted by ELECTRONIC CABLE SPECIALISTS in writing is forbidden.

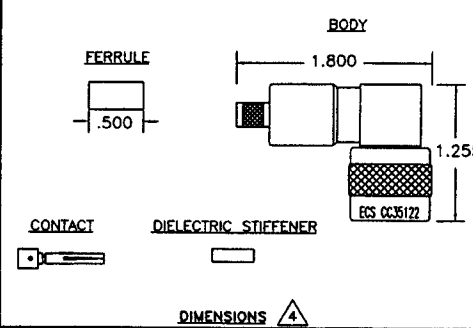

DIMENSIONS Δ

SPECIFICATIONS
ELECTRICAL
 IMPEDANCE: 50 OHMS NOMINAL
 FREQUENCY RANGE: 0-11 GHz
 VSWR: 1.30:1 MAXIMUM
 INSERTION LOSS: .1 dB MAX \bullet DC TO 2 GHz
 WORKING VOLTAGE: 1000 VRMS \bullet SEA LEVEL
 DIELECTRIC WITHSTANDING: 3000 VRMS \bullet SEA LEVEL
 INSULATION RESISTANCE: 5000 MEGOHMS MINIMUM
 \bullet 500 VOLTS DC
MECHANICAL
 CONNECTOR INTERFACE DIMENSION PER MIL-STD-348A, FIGURE 302-1.
 TERMINATION STYLE: INNER CONTACT-SOLDER OR CRIMP
 OUTER CONTACT-FERRULE CRIMP
 CABLE RETENTION: 20 LBS
ENVIRONMENTAL
 TEMPERATURE RATING: -65° TO +165° C
 VIBRATION: MIL-STD-202, METHOD 204, COND. B
 SHOCK: MIL-STD-202, METHOD 213, COND. I
 THERMAL SHOCK: MIL-STD-202, METHOD 107, COND. B
 CORROSION: MIL-STD-202, METHOD 101, COND. B
 MOISTURE RESISTANCE: MIL-STD-202, METHOD 106
MATERIALS
 BODY: BRASS PER QQ-B-626
 FERRULE: ANNEALED BRASS PER QQ-B-626
 CABLE CONTACT: BERYLLIUM COPPER PER QQ-C-530
 CENTER CONTACT: BRASS PER QQ-B-626
 OUTER CONTACT: BERYLLIUM COPPER PER QQ-C-530
 DIELECTRIC: TEFLON PER L-P-403
 GASKET: SILICONE RUBBER PER ZZ-R-765
FINISHES
 BODY, FERRULE: BRIGHT NICKEL PER QQ-N-290
 CENTER CONTACT: GOLD PER MIL-G-45204

INSTALLATION INSTRUCTIONS

- BEGIN BY CUTTING THE CABLE OFF SQUARE. 90°
- STRIP THE CABLE AS SHOWN, BEGINNING WITH L1 AND ENDING WITH L2. TAKE CARE NOT TO NICK THE CONDUCTORS WHILE STRIPPING THE DIELECTRIC AND JACKET. THE USE OF A STRIPPER DESIGNED FOR COAXIAL CABLE IS RECOMMENDED. L1 = .29
L2 = .61
- SLIDE THE FERRULE OVER THE END OF THE CABLE. Δ
- USING TWEEZERS, FOLD THE OUTER BRAID BACK OVER THE CABLE JACKET, LEAVING AS MUCH WEAVE AS POSSIBLE.
- USING TWEEZERS, FOLD THE INNER BRAID BACK OVER THE OUTER SHIELD, LEAVING AS MUCH WEAVE AS POSSIBLE.
- REMOVE THE DIELECTRIC FROM THE CENTER CONDUCTOR BACK TO THE BEGINNING OF THE FOLDED BACK SHIELD, APPROXIMATELY .60 INCHES FROM THE END OF THE CENTER CONDUCTOR. BE CAREFUL NOT TO NICK THE CENTER CONDUCTOR. THERMAL STRIPPERS ARE RECOMMENDED. .60
- INSTALL DIELECTRIC STIFFENER OVER CENTER CONDUCTOR, ENSURING THAT IT IS BUTTED AGAINST THE DIELECTRIC.
- SOLDER THE CONTACT ONTO THE CENTER CONDUCTOR, PER MIL-STD-2000, USING 63Sn/37Pb SOLDER OR CRIMP WITH M22520/5-57 DIE (B HEX). ENSURE THE CONTACT IS BUTTED AGAINST THE DIELECTRIC STIFFENER. CLEAN ALL FLUX RESIDUES USING AN APPROPRIATE FLUX CLEANER.

REVISIONS					
ECN	ZONE	REV.	DESCRIPTION	DATE	APPROVED
2976		N/C	NEW RELEASE.	8/18/95	JBH
6189		A	SEE ECN# 6189	9/10/98	MCT
13276		B	SEE ECN# 13276	7/26/01	C Chapman

- SLIDE THE BODY OF THE CONNECTOR OVER THE END OF THE CABLE UNTIL THE NOTCH IN THE CONTACT SEATS WITH THE DIELECTRIC RIDGE INSIDE THE CONNECTOR. **CAUTION:** PUSH CABLE INTO THE CONNECTOR STRAIGHT, TO AVOID KINKING THE CABLE.
- FOLD BOTH BRAIDS UP OVER THE NECK OF THE CONNECTOR BODY.
- SLIDE THE FERRULE UP OVER THE SHIELDS AND AGAINST THE CONNECTOR BODY. TRIM AWAY ANY EXCESS BRAID. CRIMP THE FERRULE ONCE, NEXT TO THE BODY, USING A M22520/5-57 DIE (A HEX) IN A M22520/5-01 TOOL FRAME. APPLY ADHESIVE HEAT SHRINK. Δ

- NOTES**
- ALL DIMENSIONS ARE IN INCHES.
 - Δ ENSURE HEAT SHRINK IS INSTALLED PRIOR TO CRIMPING CONNECTOR.
 - Δ ADHESIVE HEAT SHRINK SHOULD BE APPLIED IN ACCORDANCE WITH ECS WORK INSTRUCTION W10007. CONTACT ECS FOR A COPY OF THIS WORK INSTRUCTION.
 - Δ CONNECTOR DIMENSIONS ARE FOR REFERENCE ONLY.
 - DELETED.
 - DELETED.

ALL LENGTHS IN INCHES		ELECTRONIC CABLE SPECIALISTS FRANKLIN, WI 53132 PHONE: (414) 421-5300	
APPROVALS	DATE	TITLE: CUSTOMER SPECIFICATION	
DRAWN BY: K.W. HOFFMAN	8/3/95	C RIGHT ANGLE PLUG FOR ECS CABLE 352001	
CHECKED BY: M. TAUBENHEIM	8/18/95	SIZE: B	CAGE CODE: 66197
DESIGNED BY:		LEVEL:	PART NO. CCR3522
PROJECT ENG:		SCALE:	FILE NO. F:\ECS\COMM\INST\CCR3522
ENG. MGR: JB HACKETT	8/18/95	SHEET:	1 OF 1